


Flash codes **MATT TachoDrive** firmware v 2.58

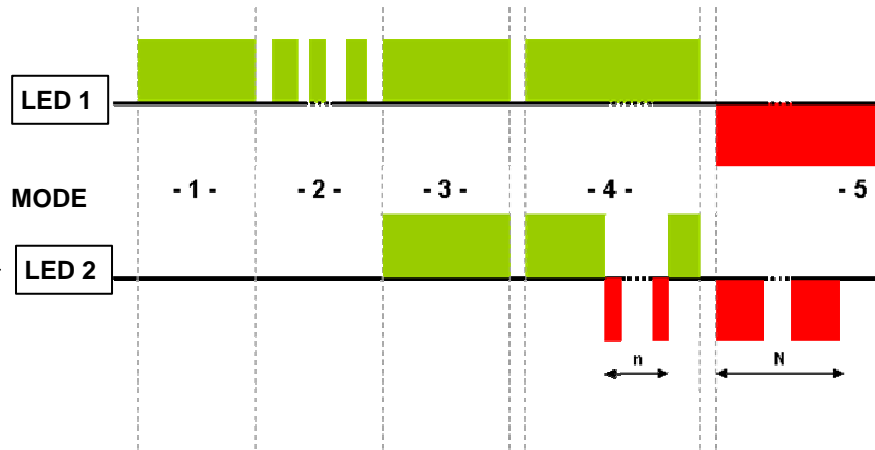

activity mode	Description	Comments
1	During connection	
2	Data transmission	
3	The data has been downloaded successfully	
4	The data has been downloaded – WARNING	
	n=1 the card is full in more than 95% of its capacity	transfer the data from the key to the PC
	n=2 the data has been downloaded partially or not at all	Reason: no data found in the tachograph for the given period or company card number
	n=3 the data from TD configuration settings has been downloaded partially	Reason: there is no DTCO-1381 specific data for this tachograph – change TD configuration
	n=4 the data from TD configuration settings has been downloaded partially	Reason: there is no driver card in the tachograph - change the configuration of the TD key or insert the card and repeat the download process
5	Error while downloading the data – ERROR	
	N=1 Incorrect conditions to execute the operation	i.e.: lack of card authorizing to download the data, ConditionsNotCorrect Or RequestSequenceError
	N=2 demanded data are not available	i.e.: lack of driver card while trying to download the data from the card, DataNotAvailable
	N=3 Unable to execute the operation	UploadNotAccepted
	N=4 The function is not supported by the tachograph	General reject, Service not supported, Subfunction not supported, Incorrect message length, Request out of range
	N=5 The tachograph is not responding	
	N=6 Tachograph communication error	
	N=7 TachoDrive memory error	Format the memory or contact the seller